

Q.2 - CLUTCH JUDDER

In instances where persistent clutch judder occurs, it is recommended that a new bracket (Part No. A074 Q 0053Z) be fitted. The bracket is fitted in the following manner.

1. Release the clutch cable from its existing abutment bracket, by slackening the tension on the cable.
2. Using two $\frac{3}{8}$ in. UNC x $\frac{1}{2}$ in. hex-headed setscrews, with spring washers (Part No. A075 W 4033Z), mount the new bracket on the non-used generator mounting lugs on the L/R front of the engine, so that the lug on the bracket faces outwards and is adjacent to the chassis.
3. Replace the clutch cable through the newly-mounted bracket, and adjust as necessary.